

SOIL EVALUATION REPORT

98092071
#EC-310-98

PROPERTY LOCATION 298 Easy St. ^{ROAD} ~~Drive~~, SILVERLAKE

APPLICANT: David Jennings PHONE: 360-225-8414

MAILING ADDRESS: P.O. Box 618, Woodland, WA 98674
CITY STATE ZIP

SPECIFICATIONS:

FOR 3 BEDROOM DWELLING: SEPTIC TANK 900 GALLON MINIMUM CAPACITY (TWO COMPARTMENT)

TYPE OF WATER SUPPLY Public DRAINFIELD 720 SQUARE FEET TOTAL MINIMUM (LENGTH X WIDTH OF TRENCHES) **RECEIVED BLDG. & PLAN**

EXISTING x PROPOSED _____

SEP 28 1993

LAYOUT OF SYSTEM:

NUMBER OF DRAINFIELD LINES: 3 OR _____
LENGTH OF DRAINFIELD LINES: 80' OR _____
WIDTH OF DRAINFIELD LINES: 3' OR _____

TRENCH DEPTH: MINIMUM 18", MAXIMUM 24"

MINIMUM DISTANCE BETWEEN TRENCHES (CENTER TO CENTER): 7.5'

ADDITIONAL REQUIREMENTS:

NOTE:

This approval indicates that this site is suitable for septic tank and drainfield use. A septic tank permit will be issued by the Department of Community Development provided the site meets the requirements of other relevant regulations such as the County Comprehensive Plan, the Subdivision Ordinance, and the Shoreline Management Plan.

- OFFICE COPY
- DCD COPY _____
Date Sent _____
- APPLICANT'S COPY _____
Date Sent _____

SUBMITTED BY: [Signature]
Date 9/29/95

-SITE CHARACTERISTICS-

Topography: General Topographic Characteristics ROLLING TERRAIN
 Drainage Characteristics: Well Drained
 Slopes: General 0 - 6 %; Proposed Drainfield Location 4 - 6 %
 Geology: Type of Bedrock & Depth No Data
 Vegetation: Thick Brush
 Distance to, and type of, nearest surface water: NA
 (If Less than 250 Feet)
 Distance to nearby wells: NA
 (If Less than 250 Feet)
 Distance to public sewers: NA
 (If Less than 250 Feet)
 Other structures on property: NA

-SOIL SERIES-

As mapped by U.S. Soil Conservation Service: SmC
 Appears to be (if different from S.C.S. Classification): _____

-SOIL LOGS

<u>Depth</u>	<u>Description</u>	<u>Comments</u>
<u>0 - 12"</u>	<u>Silt Loam</u>	<u>A Horizon</u>
<u>12 - 60"</u>	<u>" "</u>	

<u>Depth</u>	<u>Description</u>	<u>Comments</u>
<u>0 - 12"</u>	<u>Silt Loam</u>	<u>A Horizon</u>
<u>12 - 60"</u>	<u>" "</u>	

<u>Depth</u>	<u>Description</u>	<u>Comments</u>


-MAXIMUM SEASONAL GROUNDWATER ELEVATION

Soil Mottling Not Found Water Table Not Found
 (Depth Found & Degree of Development) (Depth to Standing Water)


COMMENTS: _____

VICINITY MAP MUST SHOW:

1. Location of property
2. Directional arrow indicating north
3. Any adjacent property addresses and landmarks near subject property
4. Nearest intersecting roads

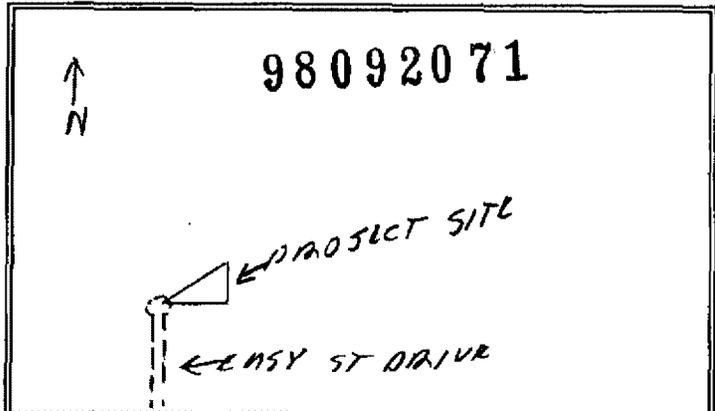

DO NOT USE SITE PLAN FRAME AS PROPERTY LINES!

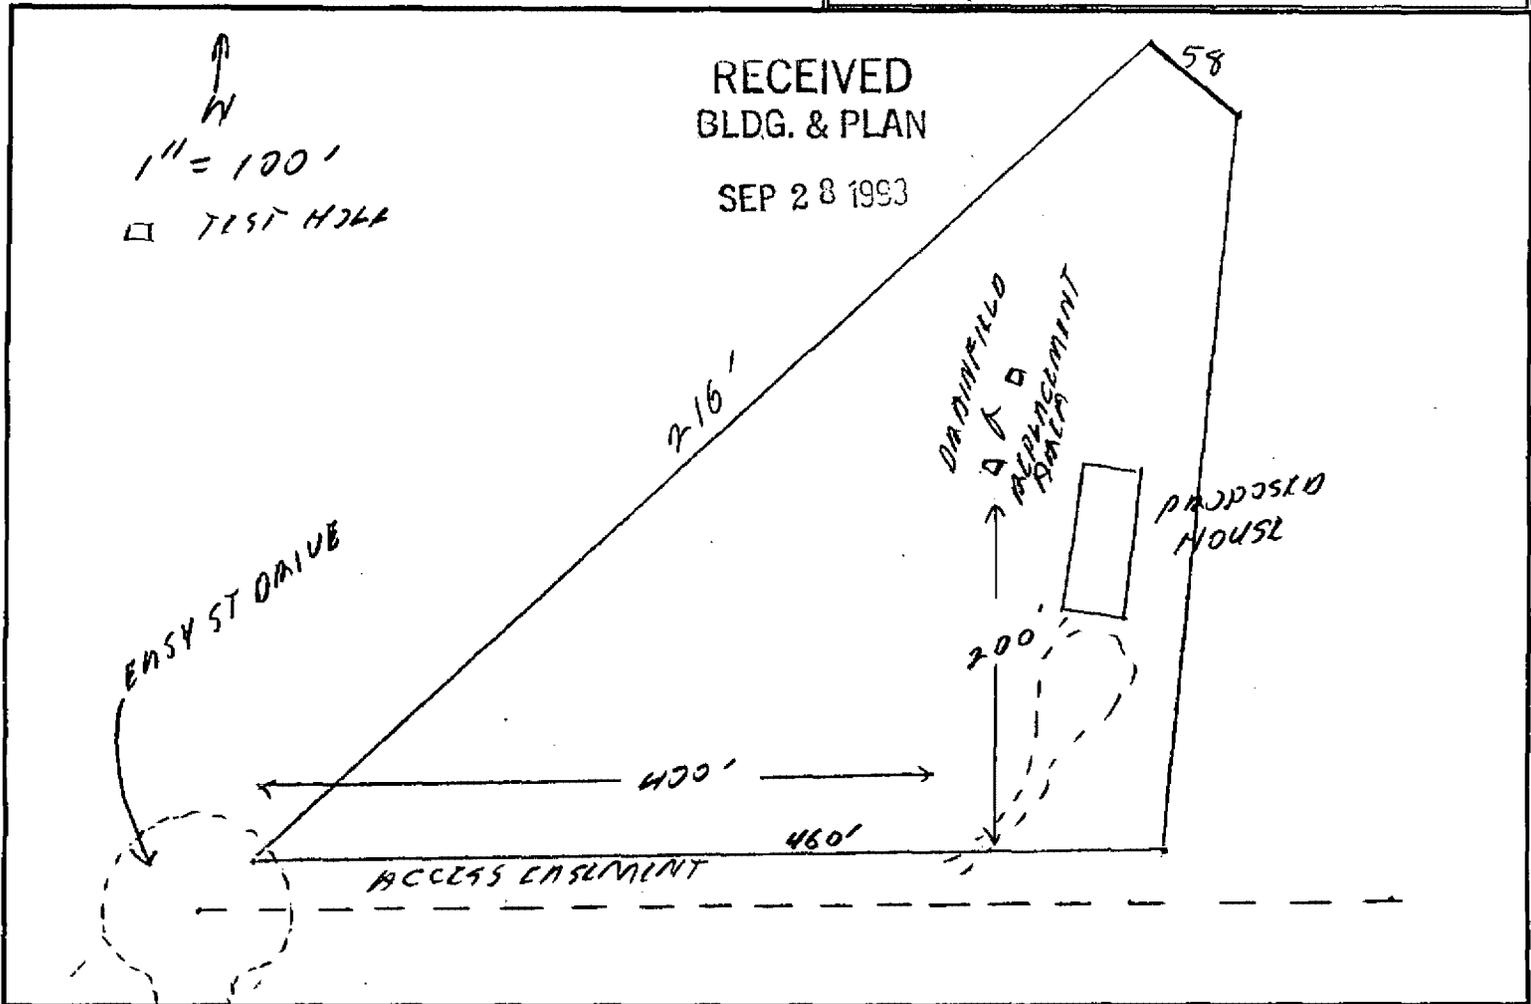

^^^^^^^^^^^^^^^^
SITE PLAN MUST SHOW:

1. Lot dimensions and property lines.
2. Directional arrow indicating north.
3. Road location and any existing or proposed driveways.
4. All proposed and existing structures, their dimensions and distances to each other, to property lines, and to centerline of road.
5. Location of soil test area, drainfield, reserve area, slope of land, well, and their distances to proposed structures or projects.
6. Location and amount of any fill or grading.
7. Location of address stake, if applicable.
8. All bodies of water, natural and manmade (streams, creeks, rivers, ditches, etc.), and distance to proposed structures or development.
9. All easements (utility, access, etc.)
10. Adjacent property addresses and uses.
11. Draw to scale, if possible.

-SITE CHARACTERISTICS

Topography: General Topographic Characteristics Rolling
 Drainage Characteristics: Some swampy areas to avoid
 Slopes: General 0 - 10 %; Proposed Drainfield Location 8 - 10 %
 Geology: Type of Bedrock & Depth pumice
 Vegetation: Mixed brush and planted fir
 Distance to, and type of, nearest surface water: NA
 (If Less than 250 Feet)
 Distance to nearby wells: NA
 (If Less than 250 Feet)
 Distance to public sewers: NA
 (If Less than 500 Feet)
 Other structures on property: NA

**RECEIVED
DCD**

-SOIL SERIES

MAR 04 1993

As mapped by U.S. Soil Conservation Service: SmC
 Appears to be (if different from S.C.S. Classification): _____

-SOIL LOGS

<u>Depth</u>	<u>Description</u>	<u>Comments</u>
<u>0 - 18</u>	<u>silt loam</u>	
<u>18 - 24</u>	<u>sandy clay loam</u>	
<u>24 -</u>	<u>sandy clay loam</u>	<u>Mottled</u>

<u>Depth</u>	<u>Description</u>	<u>Comments</u>
<u>0 - 18</u>	<u>silt loam</u>	
<u>18 - 28</u>	<u>sandy clay loam</u>	
<u>28 -</u>	<u>sandy clay loam</u>	<u>Mottled</u>

<u>Depth</u>	<u>Description</u>	<u>Comments</u>
<u>0 - 18</u>	<u>silt loam</u>	
<u>18 - 36</u>	<u>sandy clay loam</u>	
<u>36 -</u>	<u>sandy clay loam</u>	<u>Mottled</u>

-MAXIMUM SEASONAL GROUNDWATER ELEVATION

Soil Mottling: 24" - 36" Water Table Not found
 (Depth Found & Degree of Development) (Depth to Standing Water)

COMMENTS: _____

