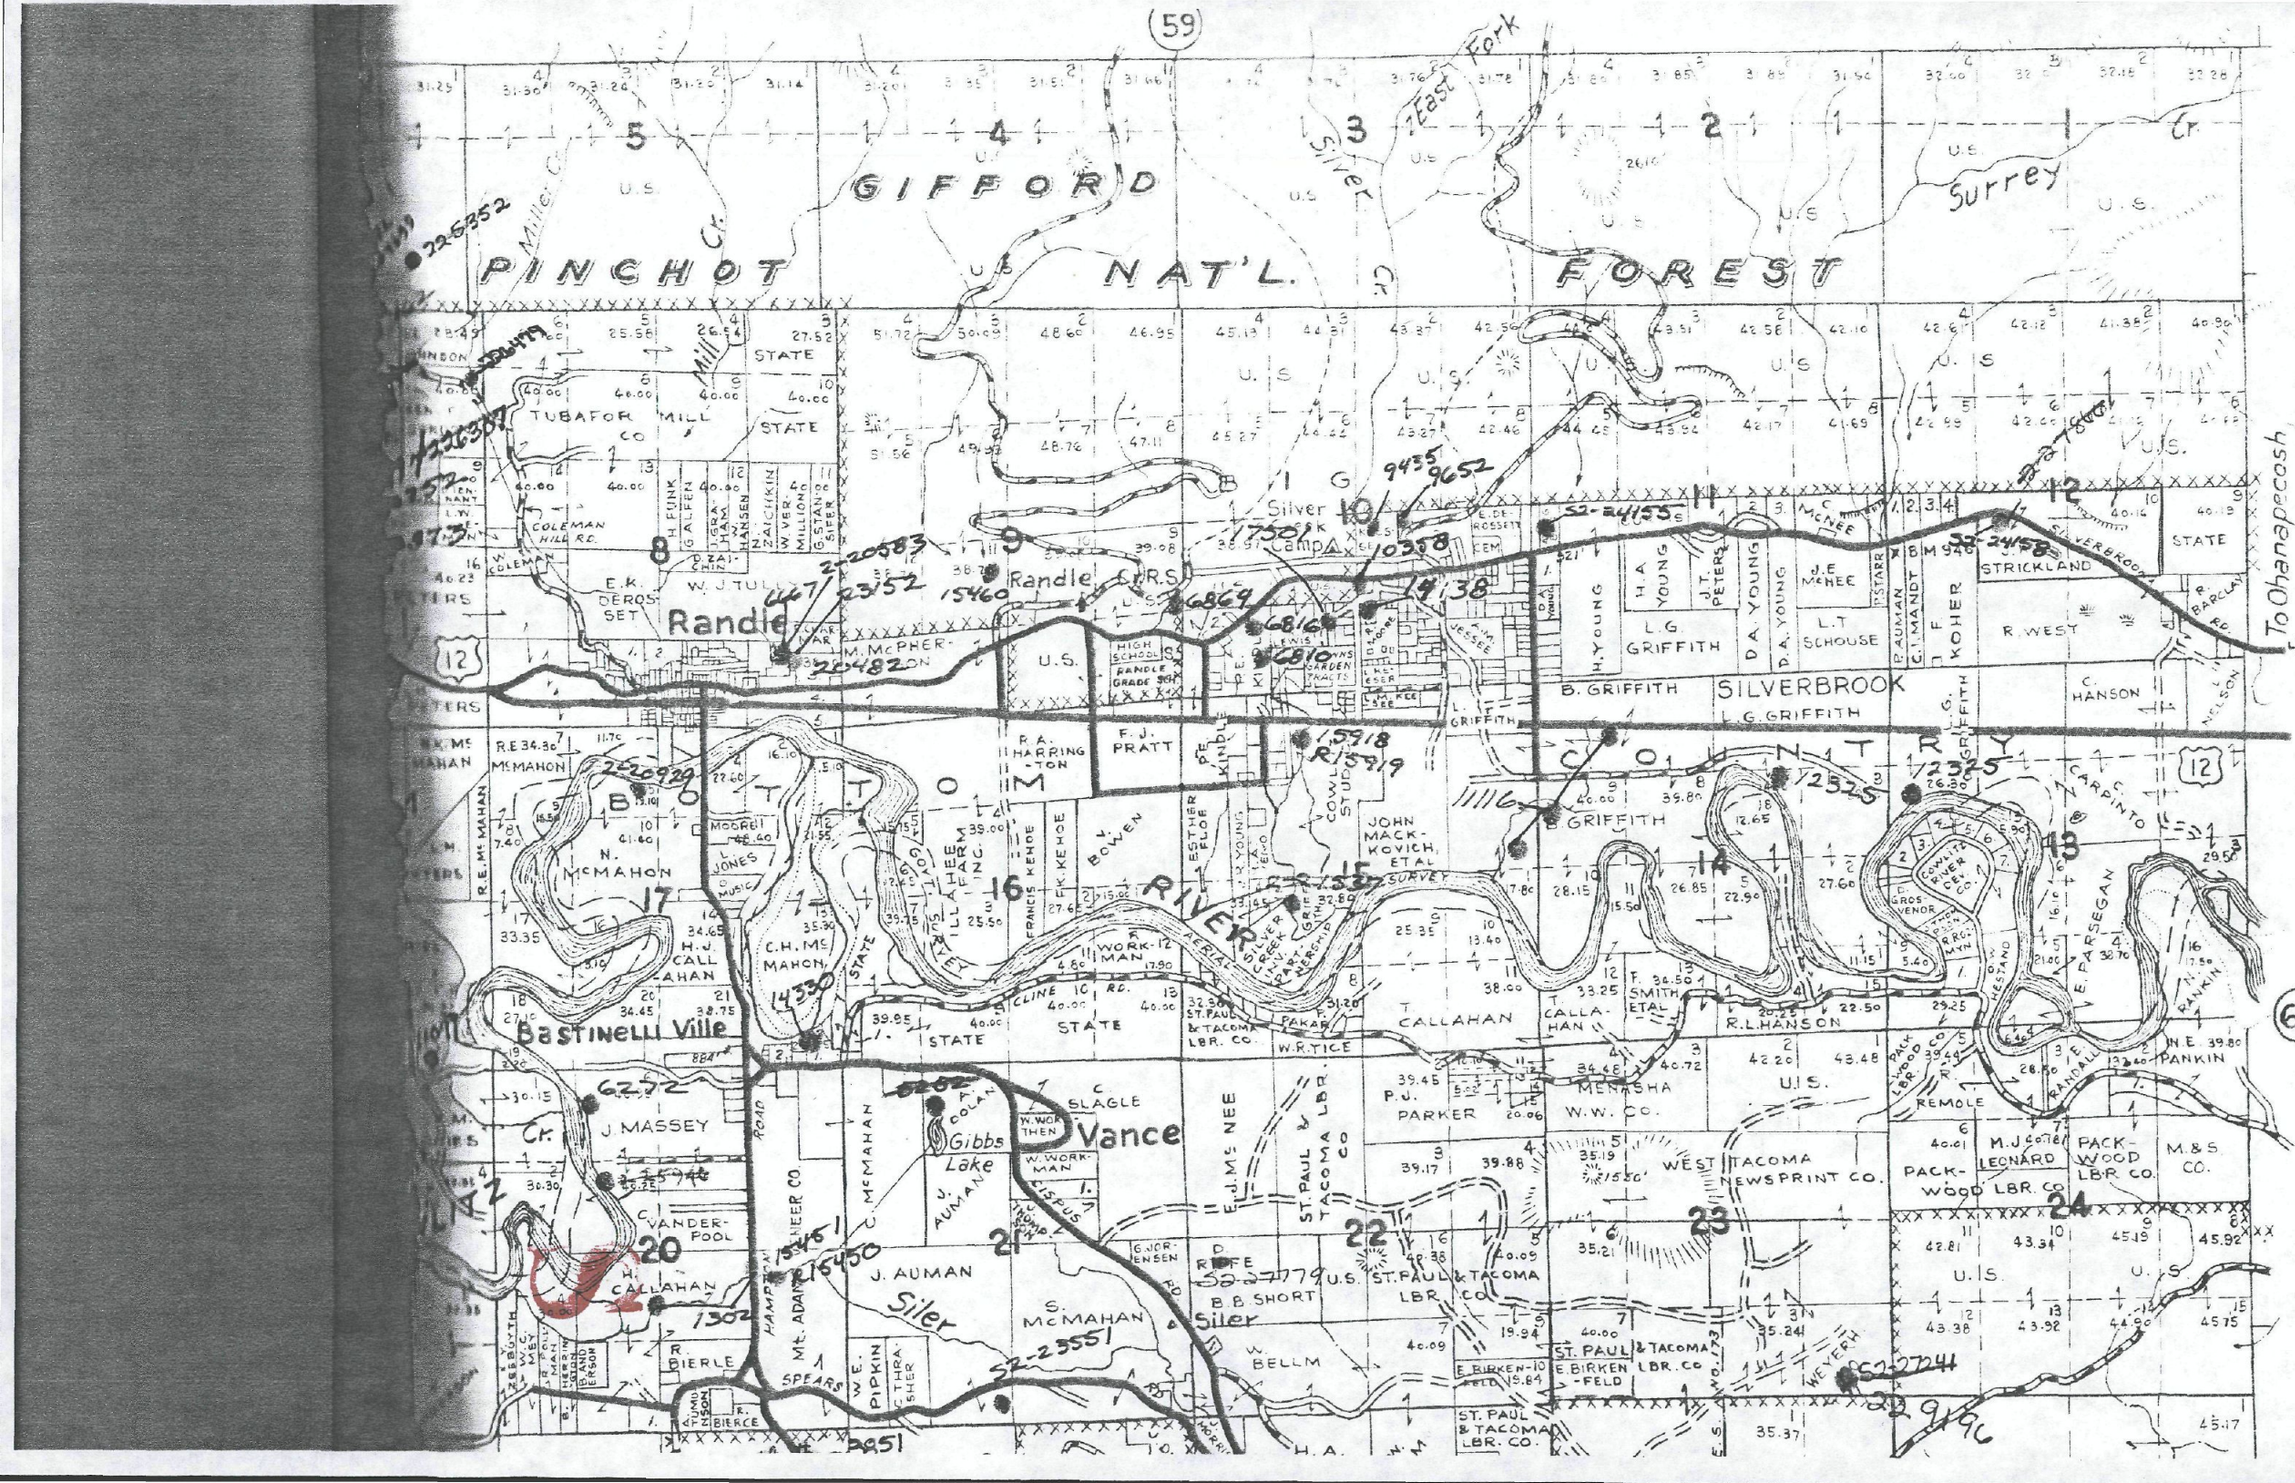
(59)
GIFFORD PINCHOT NAT'L. FOREST
East Fork Silver Cr.
Miller Cr.
Surrey Cr.
Silver Lake
Randle
SILVERBROOK
To Ohanapecosh
(12)
(62)
Bastinelli Ville
Vance
Gibbs Lake
Siler
Cr.
R.E. McMahon
N. McMahon
C.H. McMahon
J. Massey
J. Auman
S. McMahon
Mt. Adams Lbr. Co.
Hampton Lbr. Co.
St. Paul & Tacoma Lbr. Co.
West Tacoma Newsprint Co.
Packwood Lbr. Co.
Tubafor Mill Co.
Coleman Hill Rd.
Silver Creek Inv. Co.
Cowlitz River Dev. Co.
Carpinteria
Parsegian
Strickland
Schouse
Griffith
Callahan
Harrington
Pratt
Mackovich Etal
Smith Etal
Hanson
Parker
Menasha W.W. Co.
Leonard
M. & S. Co.
Rankin
Remole
Short
Bierle
Spears
Bellm
Weyerh
U.S.
STATE

Parcel # 031746-2-0

ATTACHMENT 'C'

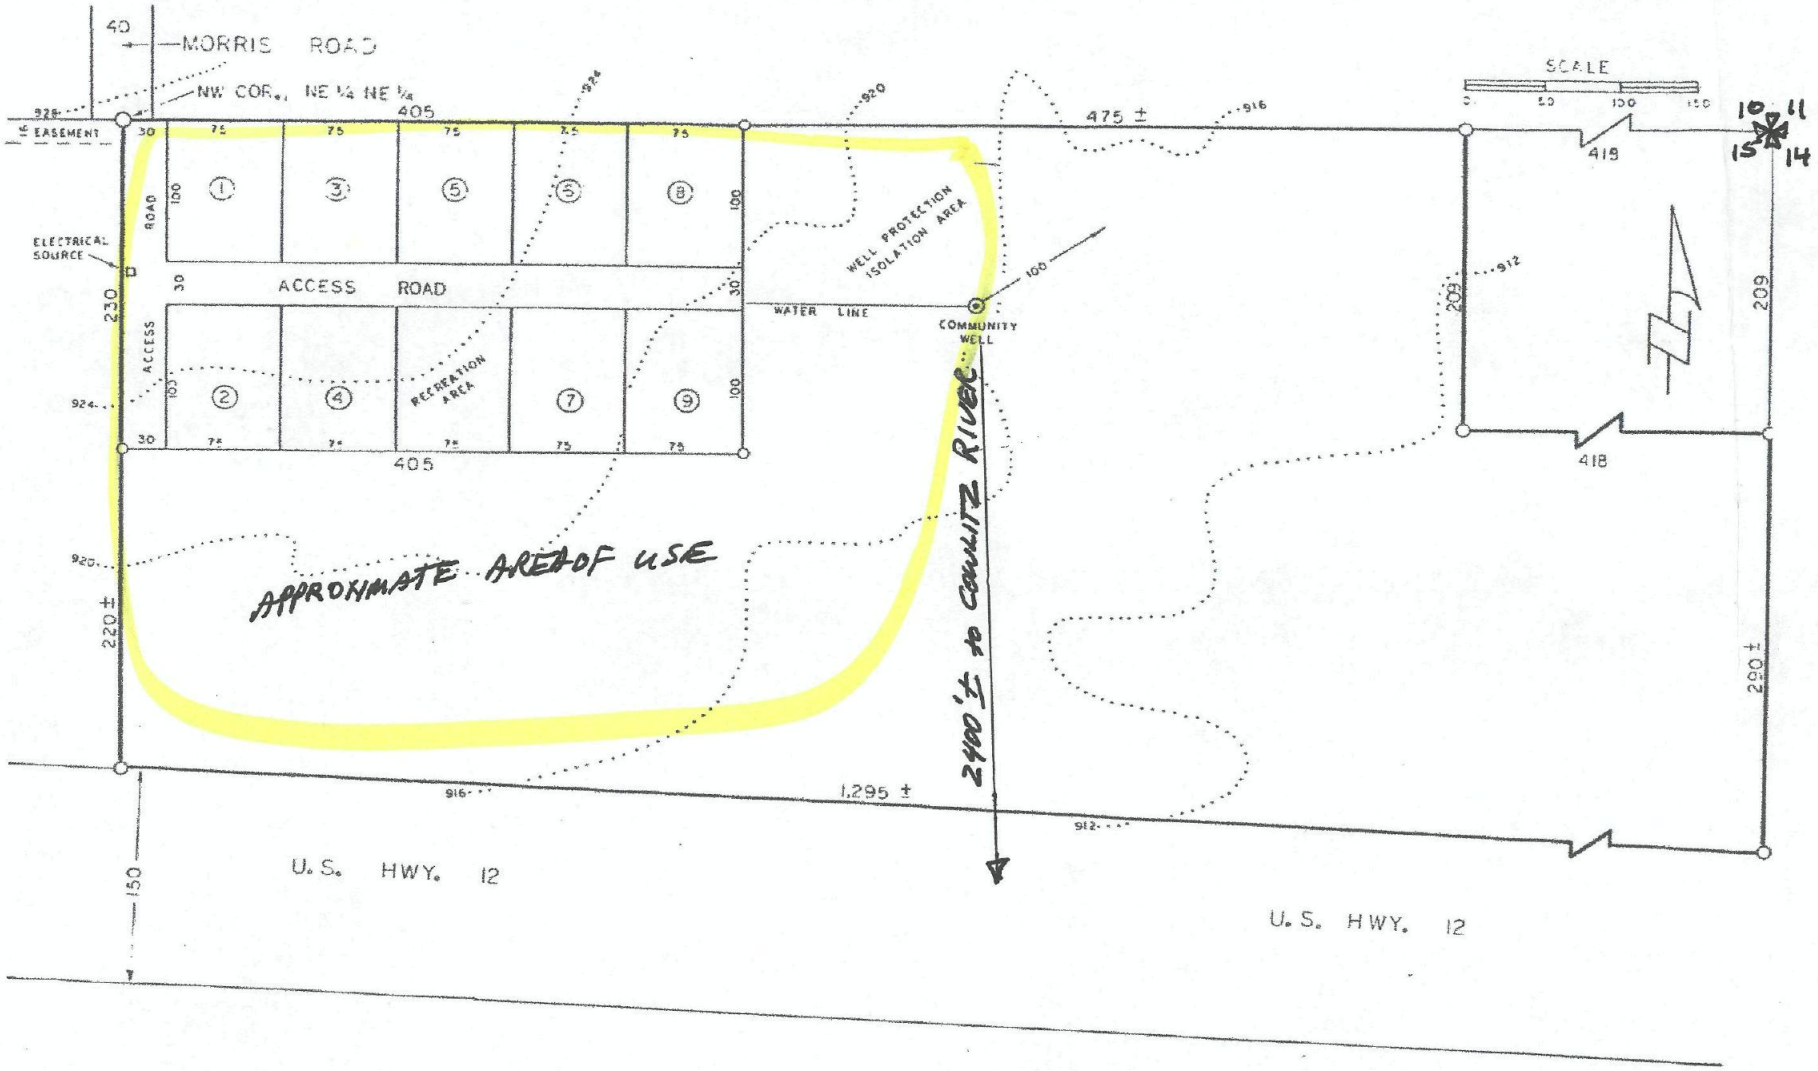

MOERKE WATER SYSTEMS, CORP.
286 N.W. Maryland Avenue
Chehalis, WA 98532
(360) 748-3805

ATTACHMENT B1

PUMP TEST

Shady Firs RV Park — Date: August 21, 2000

Well Site Address: 170 Young Road

Pump: 2 Grundfos SP4-10 — Pump Set At: Unknown

Sounder: Waterline 500

Meter: Badger M70 — Measured In Cubic Feet

TIME	GPM	METER READING	LEVEL TO WATER	NOTES
12:50 PM		984.0	31'	
12:51	44.9	990.0	32'	
12:52	44.9	996.0	32'6"	
12:53	44.9	1002.0	32'6"	
12:54	45.6	1008.1	32'6"	
12:55	46.4	1014.3	32'6"	
12:56	45.6	1020.4	32'6"	
12:57	44.1	1026.3	32'6"	
12:58	42.6	1032.0	32'6"	
12:59	45.6	1038.1	32'6"	
1:00	44.1	1044.0	32'6"	
1:01	47.9	1050.4	32'6"	
1:02	44.9	1056.4	32'6"	
1:03	41.1	1061.9	32'6"	
1:04	44.9	1067.9	32'6"	
1:05	44.9	1073.9	32'6"	
1:10	44.1	1097.5	32'6"	
1:15	44.1	1127.0	32'6"	
1:20	44.9	1156.5	32'6"	
1:25	44.1	1186.5	32'6"	
1:30	44.3	1216.0	32'6"	
2:00	44.4	1393.8	32'6"	
2:30	44.2	1572.0	32'6"	
3:00	43.3	1749.1	32'6"	
3:30	43.9	1922.8	32'6"	
4:00	43.9	2098.8	32'6"	
4:30	43.9	2274.9	32'6"	
5:00	43.9	2451.0	32'6"	
Recovery				
5:01 PM	Fully Recovered		31'	

Signature: B W Lane

Pump Technician
Moerke Water Systems, Corporation

ATTACHMENT B2

The Original and First Copy with Department of Ecology
Second Copy — Owner's Copy
Third Copy — Driller's Copy

WATER WELL REPORT
STATE OF WASHINGTON

Application No. .....
Permit No. .....

(1) OWNER: Name Blake Griffith Address Young Rd. Randle, Wa. 98377

(2) LOCATION OF WELL: County Lewis — ¼ ¼ Sec 10 T 12 N., R 2E W.M.
Bearing and distance from section or subdivision corner

(3) PROPOSED USE: Domestic ☐ Industrial ☐ Municipal ☒
Irrigation ☐ Test Well ☐ Other ☐

(4) TYPE OF WORK: Owner's number of well (if more than one) ....
New well ☒ Method: Dug ☐ Bored ☐
Deepened ☐ Cable ☐ Driven ☐
Reconditioned ☐ Rotary ☒ Jetted ☐

(5) DIMENSIONS: Diameter of well 8 inches.
Drilled 83 ft. Depth of completed well 83 ft.

(6) CONSTRUCTION DETAILS:
Casing installed: 8 " Diam. from +1 ft. to 82 ft.
Threaded ☐ " Diam. from ..... ft. to ..... ft.
Welded ☒ " Diam. from ..... ft. to ..... ft.

Perforations: Yes ☒ No ☐
Type of perforator used torch
SIZE of perforations ¼ in. by 2 in.
40 perforations from 71 ft. to 81 ft.
..... perforations from ..... ft. to ..... ft.
..... perforations from ..... ft. to ..... ft.

Screens: Yes ☐ No ☒
Manufacturer's Name.....
Type..... Model No.....
Diam. ..... Slot size ..... from ..... ft. to ..... ft.
Diam. ..... Slot size ..... from ..... ft. to ..... ft.

Gravel packed: Yes ☐ No ☒ Size of gravel: .....
Gravel placed from ..... ft. to ..... ft.

Surface seal: Yes ☒ No ☐ To what depth? 18 ft.
Material used in seal Bentonite
Did any strata contain unusable water? Yes ☐ No ☒
Type of water? ..... Depth of strata.....
Method of sealing strata off.....

) PUMP: Manufacturer's Name.....
Type: ..... H.P.....

) WATER LEVELS: Land-surface elevation above mean sea level.... ft.
tic level 25 ft. below top of well Date 4-29-82
esian pressure ..... lbs. per square inch Date.....
Artesian water is controlled by ..... (Cap, valve, etc.)

) WELL TESTS: Drawdown is amount water level is lowered below static level
s a pump test made? Yes ☐ No ☒ If yes, by whom?.....
d: gal./min. with ft. drawdown after hrs.
" " "
" " "

overy data (time taken as zero when pump turned off) (water level measured from well top to water level)

me	Water Level	Time	Water Level	Time	Water Level

(10) WELL LOG:

Formation: Describe by color, character, size of material and structure, and show thickness of aquifers and the kind and nature of the material in each stratum penetrated, with at least one entry for each change of formation.

MATERIAL	FROM	TO
Brown topsoil	0	2
" Clay, sand	2	16
" " Sand, gravel	16	19
Brown cemented " "	19	60
Brown clay, fine sand	60	70
Black sand, gravel course	70	82

RECEIVED
MAY 05 1982
Lewis County Health

Work started 4-26-82, 19..... Completed 4-29-82

WELL DRILLER'S STATEMENT:

This well was drilled under my jurisdiction and this report is true to the best of my knowledge and belief.

NAME Rover Park Electric, Inc.
(Person, firm, or corporation) (Type or print)

Address Box 116 Glenoma, Wa. 98336

Printed By: Dawn Merryman
On: 08/06/2001 At: 12:01 pm

RECEIPT

Receipt Number **02-001981**

Department of Ecology (4610)
PO Box 5128
Lacey, WA 98509-5128
(360) 407-7095

Current Document Number **461G0160CJ** Date **08/07/2001** FM **02**

Remitter Name **SHADY FIRS RV PARK**
DAVIS, JANICE S
DAVIS, CLIFFORD J

Receipt Name

Check/Draw Number **1028**
Document Amount **$10.00**
Method of Payment **Check**
Comment Description **WATER RIGHTS**

Ref Doc	Ref Doc Sfx	Inv Nr	Id Nr	Prgm Cd	T C	R	Fund	Maj Grp	Maj Src	Sub Src	Cnty	Work Cls	PIC	AI	Org	Prj	Sub Prj	Prj Phs	Sub Obj	Sub Sub Obj	Var GL	Sub Sid Dr	Sub Sid Cr	Alloc Amt
				H00	001		001	02	85	000010														$10.00